Surface Mount

To +VDC (fuse @ 1A) .... **RED**

To Chassis Ground .... **BLACK**

For Synchronization ....**YELLOW**
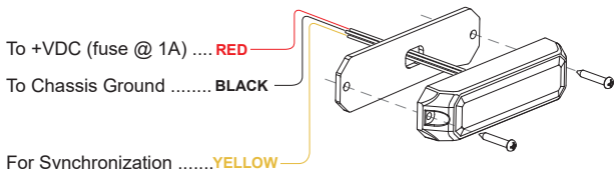   Connect YELLOW wires of multiple lightheads together for synchronization
   (All heads should be set at the same Flash Pattern)

For Simultaneous or Alternating Flash:
   1. Apply +VDC to **RED** and YELLOW wires simultaneously to enter
      Grouping mode; lighthead will display short (single or double) blips:
         . Single flash = Group1   . Double flash = Group2

   2. Remove YELLOW wire from +VDC then momentarily apply +VDC to
      change Groups:
         . Heads of the same Group will flash together.
         . Heads of the different Group will flash alternately.

For Flash Patterns:
   Momentarily apply +VDC to
   YELLOW wire:
      · once for next pattern
      · quick three times for
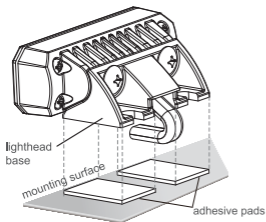   pattern 1

NOTE: This unit may not be
        factory set at FP# 1.

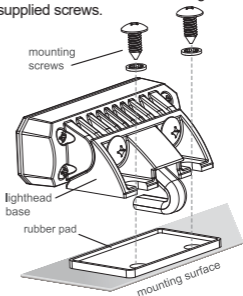| Flash Patterns	
1	Single (R65)
2	Double (R65)
3	Triple (R65)
4	Quad (2Hz)
5	Steady

Adhesive Mount

1. Select a mounting location and clean the surface.
2. Peel one side of the adhesive and apply to the lighthead base.
3. Peel the other side of the adhesive and secure the head firmly to the surface.

NOTE: Optimun adhesive strength is achieved after 24hrs.

lighthead base

mounting surface

adhesive pads

Screw Mount

1. Select a mounting location for the lighthead.
2. Mark and drill mounting holes.
3. Place the rubber pad to the bottom of the base.
4. Secure the head to the mounting surface with supplied screws.

mounting screws

lighthead base

rubber pad

mounting surface

Bracket Mount

1. Select a mounting location for the lighthead.
2. Place the rubber pad to the bottom of the base.
3. Place the head to the mounting surface.
4. Align top holes of the bracket onto the lighthead base alignment points.
5. Secure the head with supplied screws from the bottom of the bracket.

mounting surface

mounting screw

lighthead base

rubber pad

mounting surface

mounting bracket

141217